Instructions: Low Voltage Surface Mount Fixture

Model: PAN-826

## **CAUTION:**

Always turn off power at main switch prior to installation to prevent electrical shock.

Read all instructions before installing.

For installation by a qualified electrician.

System is intended for installation in accordance with National Electric Code, and local regulations.

Consult with local inspector to assure compliance.

Install over a standard 4-inch junction box.


All wires must be contained in the junction box.


## Installing fixture:

- Loosen the three-canopy screws, then twist and separate the canopy cover from the base plate.
- 2. Attach cross bar to the junction box using slotted holes.
- 3. Install threaded tube to the center hole of the cross bar. Secure the bottom of the tube with a washer and nut.
- 4. Guide the white and black wires from the transformer through the threaded tube, cross bar, and to the Junction box as shown.
- 5. Connect with like colored line volt wires from the junction box to transformer wires, with wire nuts (supplied).
- 6. Connect green grounding wire from junction box (may be bare copper wire) to green wire from fixture.
- 7. Check that white wires from the transformer are secured to white wires from the canopy.
- 8. Mount the canopy to the base plate by twisting key holes over three screws in base plate.
- 9. Tighten screws to secure canopy.

## Installing lamp & shade:

- 1. Use a 12 volt MR16 bi-pin lamp, 50Watt maximum.
- 2. Remove the lens ring by turning counter clockwise, and remove the lens.
- 3. Insert lamp pins with the holes in the socket and push fully in.
- 4. Place the lens into the lens ring and screw on to the fixture.

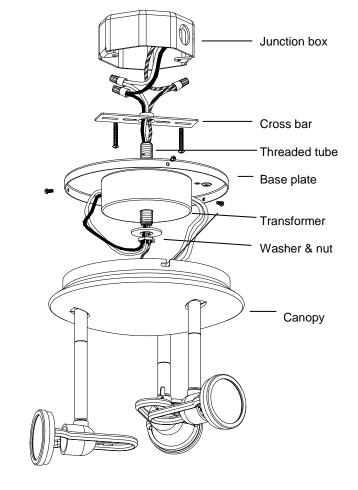

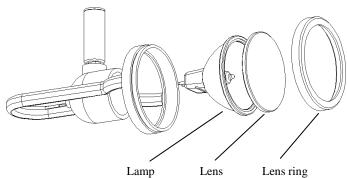



Retain these instructions for future service and adjustments 615 South Street, Garden City, NY 11530 Tel: (516) 515-5000 Fax (516) 515-5050 www.waclighting.com